



This document describes WJ-PC200/PR201/PR204 firmware upgrade Info.
 1. Release version: Version 1.031fM
 2. Release Note Reference Number: PC200/PR201/PR204-001

April 27, '16
 i-PRO Co., Ltd.

WJ-PC200 / PR201 / PR204 Firmware Release Note

VER & Release Date		Priority Rank Level	Priority Rank Level				Contents		
WJ-PC200	WJ-PR201 WJ-PR204		A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
Ver1.031cM	Ver1.031cM						First mass production.		
Ver1.031dM Feb.,'16	Ver1.031dM Feb.,'16	C				x	Camera picture looks jumpy due to signal leaked from the coaxial cable from interfering with the other coaxial cable.	When a receiver side unit that is connected to a long coaxial cable is operated together with other receiver side unit.	Fixed.
-	Ver1.031eM Mar.,'16	C				x	Camera picture looks solid black or jumpy. By signal leaked from the coaxial cable from interfering with the other coaxial cable, the camera side unit paired with the incorrect receiver side unit.	When a receiver side unit that is connected to a long coaxial cable is operated together with other receiver side unit.	Fixed.
Ver1.031fM Apr.,'16	Ver1.031fM Apr.,'16	C				x	-	-	Added manual pairing function so that correct paring between camera side units and receiver side units even if a camera side unit paired with an incorrect receiver side unit by automatic paring. Note: Please refer to the supplemental instructions how to configure manual paring.